

MM67 MULTIMETER

Instruction Manual



MARTINDALE
● ● ● ELECTRIC



ALWAYS READ THESE INSTRUCTIONS BEFORE PROCEEDING

Thank you for using one of our products. For safety and full understanding of its benefits please read this manual before use. Technical support is available via +44 (0)1923 441717 and support@martindale-electric.co.uk.

CONTENTS

1	Safety information	1
1.1	Meanings of symbols and markings	2
1.2	Precautions	2
2	Introduction	3
2.1	Inspection	3
2.2	Description	3
2.3	Accessories	4
2.4	Battery Installation	4
3	Product Specific Safety Information	5
3.1	Product specific precautions	5
4	Operation	6
4.1	General	6
4.2	Low Battery Indication	6
4.3	Description of Terminals	7
4.4	Description of Press Buttons	7
4.5	Description of LCD Symbols	7
4.6	Auto Power Off	8
4.7	Max/Min	8
4.8	Relative Function	8
4.9	Backlight	9
4.10	Manual Range Selection	9
4.11	AC & DC Voltage Measurement	9
4.12	AC & DC Current Measurement	9
4.13	Resistance Measurement	10
4.14	Capacitance Measurement	10
4.15	Frequency Measurement	10
4.16	Continuity Testing	10
4.17	Diode Testing	11

5	Maintenance	12
5.1	Battery Replacement	12
5.2	Fuse Replacement	12
5.3	Test Lead Replacement	12
5.4	Calibration	13
5.5	Cleaning	13
5.6	Repair & Service	13
5.7	Storage Conditions	13
6	Warranty	14
	Measurement categories	15
	Specifications	

1. SAFETY INFORMATION



REMEMBER: SAFETY IS NO ACCIDENT

These instructions contain both information and cautions that are necessary for the correct operation and maintenance of this product. It is recommended that you read the instructions carefully and ensure that the contents are fully understood. Failure to understand and to comply with the warnings and instructions can result in serious injury, damage or even death.

Particular attention should be paid to the warnings, precautions and technical specification.

If the equipment is used in a manner not specified by Martindale Electric, the protection provided by the equipment may be impaired.

Please keep these instructions for future reference. Updated instructions and product information are available at:
www.martindale-electric.co.uk

1.1 Meaning of symbols and markings



Equipment complies with relevant EU Directives



Caution - risk of danger & refer to instructions



Caution - risk of electric shock



Equipment protected by double or reinforced insulation (Class II)



End of life disposal of this equipment should be in accordance with relevant EU Directives



Direct current (DC)



Alternating current (AC)



Earth (ground)

1.2 Precautions

This product has been designed with your safety in mind, but please pay attention to the following warnings and cautions before use.



WARNING

These instructions contain both information and warnings that are necessary for the safe operation and maintenance of this product. It is recommended that you read the instructions carefully and ensure that the contents are fully understood. Failure to understand and to comply with the warnings and instructions can result in serious injury, damage or even death.

In order to avoid the danger of electrical shock, it is important that proper safety measures are taken when working with voltages exceeding 30V AC RMS, 42V AC peak or 60V DC.

This product must only be used by a competent person capable of interpreting the results under the conditions and for the purposes for which it has been constructed. Particular attention should be paid to the Warnings, Precautions and Technical Specifications.



Always check the unit is in good working order before use and that there are no signs of damage to it.



Do not use if damaged.



Where applicable other safety measures such as use of protective gloves, goggles etc. should be employed.

2. INTRODUCTION

2.1 Inspection

Examine the shipping carton for any sign of damage. Inspect the unit and any accessories for damage. If there is any damage then consult your distributor immediately.

2.2 Description

The MM67 is a 3.5 digit multimeter with the following measurement functions:

- True rms AC voltage to 600V
- DC voltage to 600V
- True rms AC current to 10A
- DC current to 10A
- Resistance to 66M Ω
- Capacitance to 66mF
- Frequency to 66MHz
- Continuity with audible indication
- Diode testing
- Duty cycle

Further functions are:

- Max/Min indication
- Auto power off
- Display backlight
- Relative function
- Auto ranging
- Incorrect connection warning

2.3 Accessories (included)

- TL16 test leads
- Spare 0.5A/500V, fast acting ceramic fuse
- 9V battery (installed)
- Instructions

2.4 Battery Installation

Refer to section 4.1 (Battery Replacement) for the battery installation instructions for the MM67.

3. PRODUCT SPECIFIC SAFETY INFORMATION

Measurement Category II (CAT II) is applicable to test and measuring equipment connected directly to utilization points (socket outlets and similar points) of the low-voltage MAINS installation.

Measurement Category III (CAT III) is applicable to test and measuring equipment connected to the distribution part of the building's low-voltage MAINS installation.

Measurement Category IV (CAT IV) is applicable to test and measuring equipment connected at the source of the building's low-voltage MAINS installation.

3.1 Product specific precautions

This product has been designed with your safety in mind, but please pay attention to the following warnings and cautions before use.

Warning

Before use check the unit for cracks or any other damage. Make sure the unit is free from dust, grease and moisture. Also check any associated leads and accessories for damage. Do not use if damaged.

Warning

Do not use if the battery/fuse cover is not fitted.

Warning

When this unit is used in combination with test leads, the measurement category of the combination is the lower measurement category of either this unit or the test leads used. Likewise, if test lead accessories such as crocodile clips are also used, the measurement category will be the lowest measurement category in that combination.

Warning

Always test this unit on an appropriate proving device or known voltage source before and after using it to determine if a hazardous voltage exists in a circuit to be tested.

 **Warning**

When using test leads, always keep your fingers behind the finger guard on the test lead probe.

 **Warning**

Measuring a voltage that exceeds the specified limits of the unit may damage the unit and expose the operator to a shock hazard. Always check the unit's specified limits before use.

 **Caution**

Avoid severe mechanical shock or vibration and extreme temperature.

4. OPERATION

4.1 General

If the multimeter does not measure capacitance or current on the $\mu\text{A}/\text{mA}$ ranges, the internal fuse (F1) may have blown (see section 5.2 Fuse Replacement).

If the multimeter does not measure current on the 10A the internal fuse (F2) may have blown (see section 5.2 Fuse Replacement).

If the magnitude of a parameter to be measured is unknown, but known to be within the maximum safe limits of the multimeter, then manually set the range to maximum. For example, if measuring DC voltage and the voltage magnitude is unknown, set the range to 600V, then if required select autoranging for a satisfactory reading.

If a test lead is connected to a current socket (μA mA or 10A) an alarm will sound if a corresponding function has not been selected. This is to prevent accidental overload of the current circuit.

If the multimeter displays OL or -OL then the measurement limits of the range have been exceeded.

4.2 Low Battery Indication

If the  symbol is displayed then the battery needs replacing (see section 5.1 Battery Replacement).

4.3 Description of Terminals

 $\mu\text{A mA}$	Input terminal for AC & DC current measurements to 220 mA and capacitance measurements.
10A	Input terminal for AC & DC current measurements to 10A
COM	Common terminal for all measurements
Hz VΩ	Input terminal for AC & DC voltage, resistance, continuity, diode, frequency and duty cycle measurements

4.4 Description of Press Buttons

RANGE	Switches between auto and manual ranging
MAX/MIN	Selects maximum / minimum function
	Turns the backlight on / off
	Selects the relative function

4.5 Description of LCD Symbols

APO	Auto power off is active
RANGE	Manual ranging is selected
	Diode testing function is selected
	Continuity function is selected
	Relative function is selected
MAX	Maximum indication is selected
MIN	Minimum indication is selected

mV, V, A, nF, μF, mF, Ω, kΩ, MΩ, Hz, kHz	Unit of measurement being displayed
	Indicates battery is low
DC	Indicates DC measurement
AC	Indicates AC measurement

4.6 Auto Power Off

The MM67 will auto power off after approximately 30 minutes. Pressing any button will turn the MM67 back on.

To deactivate the auto power off function press and hold the **RANGE** button while simultaneously turning the MM67 function switch from **OFF** to any position. The APO annunciator will no longer be displayed.

4.7 Max/Min

To select the Max/Min function press the **MAX/MIN** button. Alternate between displaying the maximum and minimum measured values by pressing the **MAX/MIN** button.

To exit the Max/Min function hold down the **MAX/MIN** button for 2 seconds.

4.8 Relative Function

The relative function can be used to remove an offset/residual value from a measurement.

To select the relative function press the  button to store the offset/residual value. This will now be removed from all consequent readings while the relative function is selected.

Press the  button again to exit the relative function.

4.9 Backlight

Press the  button to turn the backlight on and off.

The backlight will automatically turn off after approx 4½ minutes.

4.10 Manual Range Selection

The MM67 powers up in autoranging mode.

To manually select a range press the **RANGE** button to hold the present range, then continue to press the **RANGE** button until the required range is selected. The sequence is lowest range to highest then directly back to lowest.

To return to autoranging hold the **RANGE** button for 2 seconds.

4.11 AC & DC Voltage Measurement

Connect the black test lead to the COM terminal and the red test lead to the HzVΩ terminal.

Set the rotary switch to either AC /V or DC /V and if required manually set the range.

Taking all necessary safety precautions connect the test leads to the circuit being measured and read the measured voltage from the display.

4.12 AC & DC Current Measurement

Connect the black test lead to the **COM** terminal and the red test lead to the μ A mA or 10A terminal depending on the magnitude of current to be measured.

Set the rotary switch to either the AC or DC ranges as required.

Taking all necessary safety precautions connect the test leads in series with the circuit being measured and read the measured current from the display.

4.13 Resistance Measurement

Connect the black test lead to the **COM** terminal and the red test lead to the **HzVΩ** terminal.

Set the rotary switch to Ω and if required manually set the range.

Taking all necessary safety precautions connect the test leads to the circuit being measured and read the measured resistance from the display.

4.14 Capacitance Measurement



Be sure the capacitor being tested is completely discharged before connecting the test leads.

Connect the black test lead to the **COM** terminal and the red test lead to the $\text{—}|\text{—}$ terminal.

Set the rotary switch to $\text{—}|\text{—}$ and if required manually set the range.

Taking all necessary safety precautions, and observing the correct polarity for electrolytic capacitors, connect the test probes to the capacitor to be measured and read the measured capacitance from the display.

4.15 Frequency Measurement

Connect the black test lead to the **COM** terminal and the red test lead to the **HzVΩ** terminal.

Set the rotary switch to Hz and if required press the Hz button to select the frequency function. If required manually set the range.

Taking all necessary safety precautions connect the test leads to the circuit being measured and read the measured frequency from the display.

4.16 Continuity Testing

Connect the black test lead to the **COM** terminal and the red test lead to the **HzVΩ** terminal.

10 Set the rotary switch to $\bullet\text{))}$.

Taking all necessary safety precautions connect the test leads to the circuit being tested.

The buzzer will sound if the resistance is $<30\Omega$.

4.17 Diode Testing

If the diode to be tested is in circuit be sure the circuit power is switched off.

Connect the black test lead to the **COM** terminal and the red test lead to the **H ν V Ω** terminal.

Set the rotary switch to  .

Taking all necessary safety precautions connect the test leads to the diode being tested.

If the diode is good a forward bias will give a display reading of around 0.6 V (silicon diode) and a reverse bias will give a display of OL. If the diode is shorted or open circuit the display will indicate approx 0V or OL respectively for both forward and reverse bias.

5. MAINTENANCE

5.1 Battery Replacement

 **To avoid shock or injury, disconnect the multimeter from any external circuits or components and remove the test leads before proceeding.**

Replace the battery by removing the two screws from the battery cover and lifting the battery cover.

Fit a new 9V, NEDA 1604, JIS006P, IEC 6F22 battery and replace the battery cover and screws.

5.2 Fuse Replacement

 **To avoid shock, injury or damage to the multimeter, disconnect the multimeter from any external circuits or components and remove the test leads before proceeding.**

 **Replace only with the fuse specified.**

Replace the fuses by removing the three screws securing the rear casing, and lift off the rear casing.

Replace F1 only with the original type 0.5A/500V, fast acting ceramic fuse and replace F2 only with the original type 10A/600V, fast acting ceramic fuse.

Replace the rear casing and screws.

5.3 Test Lead Replacement

If the test leads become damaged they should be replaced.

 **The replacement test leads must have the same (or better) overvoltage category rating as the TL16 leads supplied**

5.4 Calibration

To maintain the integrity of measurements made using your instrument, Martindale Electric recommends that it is returned at least once a year to an approved Calibration Laboratory for recalibration and certification.

Martindale Electric is pleased to offer you this service. Please contact our Service Department for details.

Email: service@martindale-electric.co.uk

Tel: +44 (0)1923 650660

5.5 Cleaning

The unit may be cleaned using a soft dry cloth. Do not use moisture, abrasives, solvents, or detergents, which can be conductive.

5.6 Repair & Service

There are no user serviceable parts in this unit other than those that may be described in section 2. Return to Martindale Electric if faulty. Our service department will quote promptly to repair any fault that occurs outside the guarantee period.

Before the unit is returned, please ensure that you have checked the unit for flat batteries, blown fuses, poor connections and faulty / damaged leads.

5.7 Storage Conditions

The instrument should be kept in warm dry conditions away from direct sources of heat or sunlight, and in such a manner as to preserve the working life of the unit. It is strongly advised that the unit is not kept in a tool box where other tools may damage it.

6. WARRANTY AND LIMITATION OF LIABILITY

This Martindale product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is 2 years and begins on the date of receipt by the end user. This warranty extends only to the original buyer or end-user customer, and does not apply to fuses, disposable batteries, test leads or to any product which, in Martindale's reasonable opinion, has been misused, altered, neglected, contaminated, or damaged by accident or abnormal conditions of operation, handling or storage.

Martindale authorised resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Martindale.

Martindale's warranty obligation is limited, at Martindale's option, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to Martindale within the warranty period.

This warranty is the buyer's sole and exclusive remedy and is in lieu of all other warranties, expressed or implied, including but not limited to any implied warranty of merchantability or fitness for a particular purpose. Martindale shall not be liable for any special, indirect, incidental or consequential damages or losses, including loss of data, arising from any cause or theory.

Since some jurisdictions do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any part of any provision of this warranty is held invalid or unenforceable by a court or other decision-maker of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision or other part of that provision.

Nothing in this statement reduces your statutory rights.

MEASUREMENT CATEGORIES

CAT Ratings

BS EN61010-1 Installation Categories (CAT ratings) define the risks from hazardous transient impulses and potentially lethal short circuit currents on the mains supply system based on where you are working.

Voltage Ratings

Test equipment used for measuring mains circuits will have a CAT rating to show where it can be used. Each category also has a voltage rating to show the maximum safe phase to earth system voltage, normally 50V, 100V, 150V, 300V, 600V or 1000V.


Stay safe - Match your test equipment safety rating to the installation category.

CAT II: Socket outlets and similar points of the mains installation.

CAT III: The distribution part of the building's mains installation.

CAT IV: The supply side source of the building's mains installation.

Testers, leads and accessories all need safety ratings equivalent to, or higher than the installation category and voltage rating for the location to be safe.

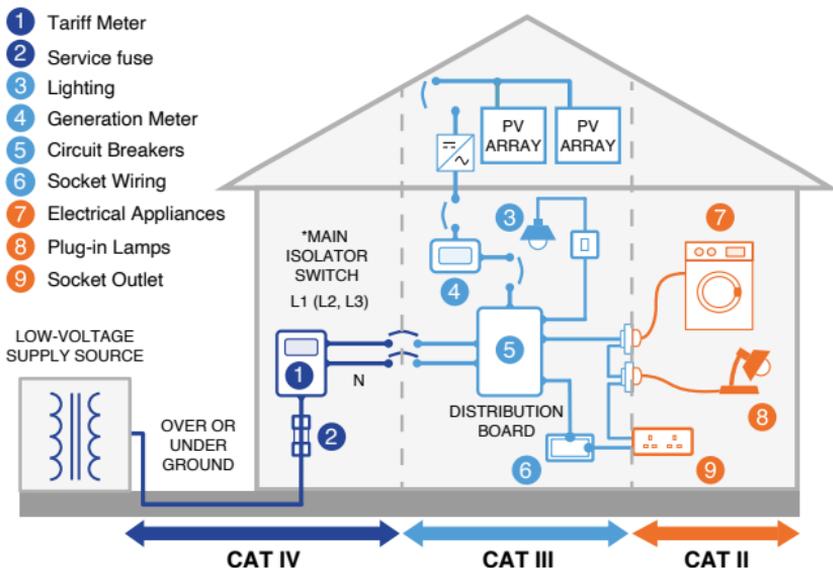



Specification

MM67

Digital Multimeter



GENERAL

Display: 3.5 digit liquid crystal display with a maximum reading of 6600.

Polarity: Automatic, positive implied, negative polarity indication

Overrange: (OL) or (-OL) is displayed

Zero: Automatic

Low battery indication:  symbol is displayed when the battery voltage drops below the operating level

Measurement rate: 2 times per second, nominal

Auto power off: After approx. 30 minutes

Operating environment: 0°C to 50°C at < 70% RH

Storage temperature: -20°C to 60°C at < 80% RH

Altitude: Up to 2000m

Power: Single standard 9 volt battery, NEDA

1604, JIS006P, IEC 6F22.

Battery Life: 150 hours typical with carbon-zinc batteries

Dimensions: 165mm (H) x 78mm (W) x 42.5mm (D)

Weight: Approx. 285g

Includes: Test leads, 1 x spare fuse, 9V battery (installed) and instructions

ELECTRICAL

All specified accuracies are at 23°C \pm 5°C, <75% RH for 1 year.

Temperature Coefficient: 0.1 x (specified accuracy) per °C. (0°C to 18°C, 28°C to 50°C)

DC VOLTS

Ranges: 660mV, 6.6V, 66V, 600V

Best resolution: 0.1mV

Accuracy: \pm (0.5% rdg + 2 dgt)

Input impedance: 660mV: >100M Ω ; 6.6V:10M Ω ; 66V ~ 600V:9.1M Ω

Overload protection: 600VDC or AC rms



Specification

MM67

Digital Multimeter

AC VOLTS (TRUE RMS) (50Hz - 500Hz)

Ranges: 660mV, 6.6V, 66V, 600V

Best resolution: 0.1mV

Accuracy: $\pm(1.5\% \text{ rdg} + 8 \text{ dgts})$ 50 ~ 60Hz on 660mV range
 $\pm(1.5\% \text{ rdg} + 8 \text{ dgts})$

Crest factor: ≤ 3

AC coupled true rms specified from 5% to 100% of range.

Input impedance: 660mV: $>100\text{M}\Omega$; 6.6V: $10\text{M}\Omega$; 66V ~ 600V: $9.1\text{M}\Omega$

Overload protection: 600VDC or AC rms

CURRENT

Ranges: 660uA, 6600uA, 66mA, 400mA, 10A

Best resolution: 0.1uA

DC accuracy:

$\pm(1.5\% \text{ rdg} + 2 \text{ dgts})$ on 660uA to 400mA ranges

$\pm(3.0\% \text{ rdg} + 3 \text{ dgts})$ on 10A range

AC accuracy: (TRUE RMS) (50Hz ~ 500Hz)

$\pm(2.0\% \text{ rdg} + 10 \text{ dgts})$ on 660uA to 400mA ranges

$\pm(3.5\% \text{ rdg} + 10 \text{ dgts})$ on 10A range

Crest factor: ≤ 3

AC coupled true rms specified from 5% to 100% of range.

Voltage burden: 0.4V on 660uA, 66mA, 10A ranges
2V on 6600uA, 400mA ranges

Input protection: 0.5A/500V fast blow ceramic fuse

10A/600V fast blow ceramic fuse

10A input: 10A for 60 seconds maximum followed by a 10 minutes cooling period.

RESISTANCE

Ranges: 660 Ω , 6.6k Ω , 66k Ω , 660k Ω , 6.6M Ω , 66M Ω

Resolution: 0.1 Ω

Accuracy:

$\pm(1.2\% \text{ rdg} + 5 \text{ dgts})$ on 660 Ω to 660k Ω ranges

$\pm(2.0\% \text{ rdg} + 5 \text{ dgt})$ on 6.6M Ω range

$\pm(3.5\% \text{ rdg} + 5 \text{ dgt})$ on 66M Ω range

Open circuit volts: -0.45Vdc (-1.2Vdc on 660 Ω range)

Overload protection: 500VDC or AC rms



Specification

MM67

Digital Multimeter

CAPACITANCE (MFD)

Ranges: 6.6nF, 66nF, 660nF, 6.6uF, 66uF, 660uF, 6.6mF, 66mF

Best resolution: 1PF

Accuracy:

±(3.0% rdg + 30 dgts) on 6.6nF range

±(3.0% rdg + 5 dgts) on 66nF to 660μF ranges

±(5.0% rdg + 20 dgts) on 6.6mF, 66mF ranges

Overload protection: 500VDC or AC rms

FREQUENCY

Ranges: 660Hz, 6.6kHz, 66kHz, 660kHz, 6.6MHz, 66MHz

Best resolution: 0.1Hz

Accuracy: ± (0.1% rdg + 3 dgts)

Sensitivity: 10Hz ~ 6.6MHz: >2.5V rms, 6.6MHz

~ 66MHz: >2.5V rms <5V rms

Minimum pulse width: > 25ns

Duty cycle limits: > 30% and < 70%

Overload protection: 500VDC or AC rms

DIODE TEST

Test current: 1.2mA (approximate)

Accuracy: ±(3.0% rdg + 3 dgts)

Resolution: 1mV

Audible indication: <0.03V

Open circuit volts: 3.5Vdc typical

Overload protection: 500VDC or AC rms

CONTINUITY

Audible indication: Less than 30Ω

Response time: 100ms

Overload protection: 500VDC or AC rms

SAFETY:

Conforms to BS EN 61010-1, CAT III 600 V

Class II Double Insulation

Pollution Degree: 2 for indoor use

Test leads conform to BS EN 61010-031, CAT III 1000V, CAT IV 600V, 10A.

EMC: Conforms to BS EN 61326.

Check out what else you can get from Martindale:

- 18th Edition Testers
- Accessories
- Cable Locators
- Calibration Equipment
- Continuity Testers
- Digital Clamp Meters
- Digital Multimeters
- Electricians' Kits
- Environmental Products
- Full Calibration & Repair Service
- Fuse Finders
- Labels
- Microwave Leakage Detectors
- Multifunction Testers
- PAT Testers & Accessories
- Phase Rotation Testers
- Proving Units
- Safe Isolation Kits
- Socket Testers
- Specialist Drummond Testers
- Thermometers & Probes
- Test Leads
- Voltage Indicators

Martindale Electric Co. Ltd. Metrohm House,
12 Imperial Park, Imperial Way, Watford WD24 4PP, UK.

T: +44 (0)1923 441717

www.martindale-electric.co.uk sales@martindale-electric.co.uk

Ver. F1.0

Due to policy of continuous development, Martindale Electric reserves the right to alter equipment specification and description outlined in this document without prior notice. No part of this document shall be deemed to be part of any contract for the equipment unless specifically referred to as an inclusion within such contract. © 2025 Martindale Electric Co. Ltd. Registered in England No. 3387451. LITMM67